



■ 快插接头（高温拧紧式） P08-C410S

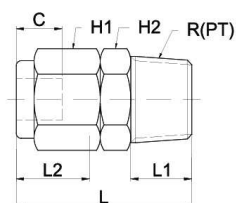

[单位: mm]

型号选择 型号	R(PT)	适用软管 外径 D	C	L	L1	L2	H1	H2		
P08-C410S01-6	1/8	6×4	6.0	25.5	8	11.5	12.0	12		
P08-C410S01-8	1/8	8×6	7.0	27.5	8	13.5	14.0	14		
P08-C410S02-6	1/4	6×4	6.0	28.5	11	11.5	12.0	14		
P08-C410S02-8	1/4	8×6	7.0	30.5	11	13.5	14.0	14		
P08-C410S02-10	1/4	10×7.5	9.0	33.5	11	16.5	17.0	17		
P08-C410S02-12	1/4	12×9	9.0	33.5	11	16.5	19.0	19		
P08-C410S03-6	3/8	6×4	6.0	29.5	12	11.5	12.0	17		
P08-C410S03-8	3/8	8×6	7.0	31.5	12	13.5	14.0	17		
P08-C410S03-10	3/8	10×7.5	9.0	34.5	12	16.5	17.0	17		
P08-C410S03-12	3/8	12×9	9.0	34.5	12	16.5	19.0	19		
P08-C410S04-10	1/2	10×7.5	9.0	37.5	15	16.5	17.0	21		
P08-C410S04-12	1/2	12×9	9.0	37.5	15	16.5	19.0	21		

■ 快插接头（高温拧紧L式） P08-C411S

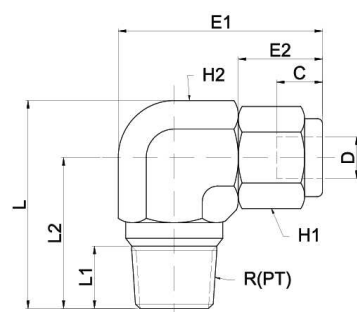

[单位: mm]

型号选择 型号	R(PT)	适用软管 外径 D	C	E1	E2	L	L1	L2	H1	H2
P08-C411S01-6	1/8	6×4	6.0	27.9	11.5	27.9	8.0	21	12	12
P08-C411S01-8	1/8	8×6	7.0	34.8	13.5	34.8	8.0	25	14	17
P08-C411S02-6	1/4	6×4	6.0	30.1	11.5	30.1	11.0	22	12	14
P08-C411S02-8	1/4	8×6	7.0	34.8	13.5	34.8	11.0	25	14	17
P08-C411S02-10	1/4	10×7.5	9.0	40.0	16.5	40.0	11.0	29	17	19
P08-C411S02-12	1/4	12×9	9.0	40.0	16.5	40.0	11.0	29	19	19
P08-C411S03-6	3/8	6×4	6.0	40.0	11.5	40.0	12.0	29	12	19
P08-C411S03-8	3/8	8×6	7.0	40.0	13.5	40.0	12.0	29	14	19
P08-C411S03-10	3/8	10×7.5	9.0	40.0	16.5	40.0	12.0	29	17	19
P08-C411S03-12	3/8	12×9	9.0	40.0	16.5	40.0	12.0	29	19	19
P08-C411S04-10	1/2	10×7.5	9.0	44.3	16.5	44.3	15.0	31	17	23
P08-C411S04-12	1/2	12×9	9.0	44.3	16.5	44.3	15.0	31	19	23