



■ 快插接头（连接式） P08-C412

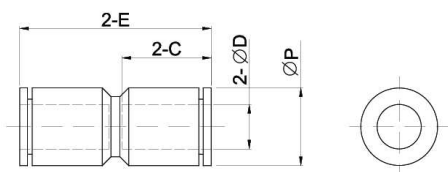

[单位: mm]

型号选择	适用软管 外径 D	L	P	C	温度				
型号									
P08-C412-6	6	34.9	12.5	17.0	60℃				
P08-C412-8	8	37.8	14.5	18.1	60℃				
P08-C412-10	10	43.4	17.5	20.2	60℃				
P08-C412-12	12	47.8	21.0	23.4	60℃				


■ 快插接头（L型连接式） P08-C413

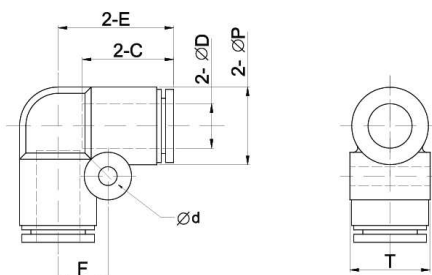

[单位: mm]

型号选择	适用软管 外径 D	E	C	P	F	d	T	温度	
型号									
P08-C413-6	6	20.1	16.9	12.5	8.0	3.2	12.5	60℃	
P08-C413-8	8	22.4	18.1	15.0	10.0	4.2	15.6	60℃	
P08-C413-10	10	26.2	20.7	17.5	12.0	4.2	18.2	60℃	
P08-C413-12	12	29.4	23.4	21.0	14.0	4.2	21.7	60℃	

■ 快插接头（分路连接式） P08-C414

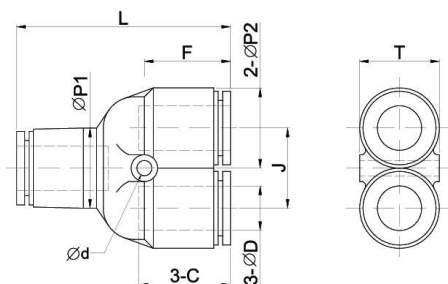

[单位: mm]

型号选择	适用软管 外径 D	L	F	P1	P2	C	d	T	温度
型号									
P08-C414-6	6	37.7	15.8	13.0	12.5	17.0	3.4	12.5	60℃
P08-C414-8	8	42.4	17.2	15.0	14.5	18.1	3.4	14.5	60℃
P08-C414-10	10	48.4	19.5	18.0	18.0	20.7	4.5	18.0	60℃
P08-C414-12	12	54.8	22.2	21.5	21.0	23.4	4.2	21.0	60℃