


■ 快插接头（分路螺纹L式） P08-C415




[单位: mm]

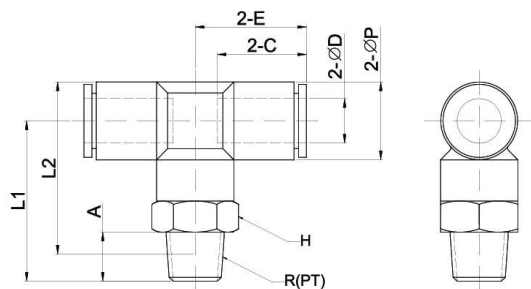

型号选择 型号	R (PT)	适用软管 外径 D	L1	L2	P	E	C	H	A	温度
P08-C41502-6	1/4	6	29.0	29.5	13.0	20.2	17.0	14	11	60℃
P08-C41502-8	1/4	8	29.3	30.8	15.0	22.4	18.4	14	11	60℃
P08-C41502-10	1/4	10	36.0	38.7	17.5	25.2	20.2	17	11	60℃
P08-C41502-12	1/4	12	38.0	42.5	21.0	28.4	22.9	21	11	60℃
P08-C41503-6	3/8	6	30.8	31.0	13.0	20.2	17.0	17	12	60℃
P08-C41503-8	3/8	8	31.1	32.3	15.0	22.4	18.4	17	12	60℃
P08-C41503-10	3/8	10	37.0	39.4	17.5	25.2	20.2	17	12	60℃
P08-C41503-12	3/8	12	39.0	43.2	21.0	28.4	22.9	21	12	60℃
P08-C41504-10	1/2	10	40.0	40.6	17.5	25.2	20.2	21	15	60℃
P08-C41504-12	1/2	12	42.0	44.3	21.0	28.4	22.9	21	15	60℃

■ 快插接头（分路螺纹式） P08-C416

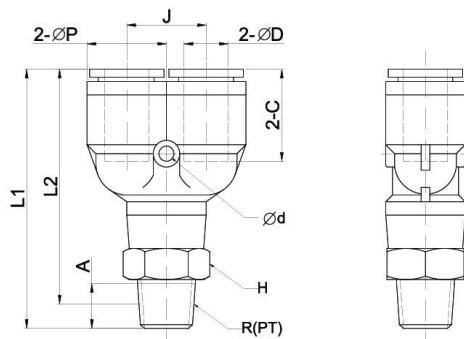

[单位: mm]



型号选择 型号	R (PT)	适用软管 外径 D	L1	L2	P	J	C	H	A	温度
P08-C41602-6	1/4	6	47.4	41.3	12.5	12.0	17.0	14	11	60℃
P08-C41602-8	1/4	8	51.7	45.7	14.5	14.0	18.1	14	11	60℃
P08-C41602-10	1/4	10	58.3	52.3	18.0	18.0	20.7	17	11	60℃
P08-C41602-12	1/4	12	63.5	57.5	21.0	20.0	23.4	21	11	60℃
P08-C41603-6	3/8	6	49.2	42.8	12.5	12.0	17.0	17	12	60℃
P08-C41603-8	3/8	8	53.5	47.2	14.5	14.0	18.1	17	12	60℃
P08-C41603-10	3/8	10	59.3	53.0	18.0	18.0	20.7	17	12	60℃
P08-C41603-12	3/8	12	64.5	58.2	21.0	20.0	23.4	21	12	60℃
P08-C41604-10	1/2	10	62.3	54.1	18.0	18.0	20.7	21	15	60℃
P08-C41604-12	1/2	12	67.5	59.3	21.0	20.0	23.4	21	15	60℃